

Errata- StationPro II Operating and Assembly Manual
(revised 12/11/2010 - corrections to manual version 5/07/2010)

Please make the following changes in your manual.

Page 27:

In the table at the top of the page, change the Mic+ (Audio Out) entry for Icom from pin 8 to pin 1.

Replace Step (25) with the following:

“(25) Insert two red LEDs into DS305 and DS310 (flat side down). Do not solder the LEDs.”

Page 33:


Change the first sentence of step (15) to “Set aside the completed main printed circuit board.”

Page 37:

Move step (4) [installation of 4700 μ F electrolytic capacitor] so that it follows step (9) on page 38. The capacitor is a tall component, and moving this step will make it easier to install the 24 pin IC socket and the relays.

Page 45:

In Step (e), the drawing has the retaining clip shown on the wrong side of the program connector. Please correct the drawing or replace it with the following:

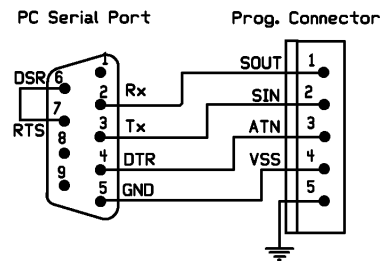

Page 46:

Under **VIII. Programming and Checkout of the Controller**, replace Step (2) with the following:

“(2) Download the latest firmware version for the StationPro II from <http://www.w8zr.net/stationpro/spdownload.htm> The file name for the firmware has the form **StnPro_code_08_11_09.bs2**, where the “08_11_09” refers to the release date. Obviously you should download the latest release date. To download, right click (for

Windows) the link and save the file to your hard disk. Be sure the saved file has the same file name as the original file.”

Page 47:

Insert the following sentence immediately *before* the sentence in the middle of the page that reads “When you are done, press Ctrl+S to save your program.”

“Next, scroll down to “Part II,” of the Owner Supplied Data section, which gives you the option of locking out specific amplifier/transceiver combinations. Follow the directions in the program listing, or skip this step if you do not want to lock out any amplifier selections.”

Page 66:

Change “D101-D107”, to “D101-D107, D109” and change quantity from 7 to 8.

Page 67:

Change the part number for J111 (5 pin DIN connector) from 161-0505 to 161-0505E.

Page 74:

Change the part number for J501 to:

J501	Connector	RJ-45 8 pin, top entry, shielded, PCB mount, qty 1 Mouser p/n 571-6116202-1 Price \$2.41/ea, \$2.19/25, \$2.02/50, \$1.95/100
------	-----------	---